




Floorcare & Specialty Motors

DESCRIPTION

- Double-stage tapered fan system
- 8.4" / 213 mm diameter
- Improved sound quality
- "True" tangential discharge bracket
- 240 volts AC
- 3.5" High-Efficiency lamination
- Double ball bearings; 10mm output

DESIGN APPLICATION

- Commercial and Residential Central Cleaning Systems
- Car wash vac and blower systems
- Equipment operating in environments requiring separation of working air from motor ventilating air
- Designed to handle clean, dry, filtered air only

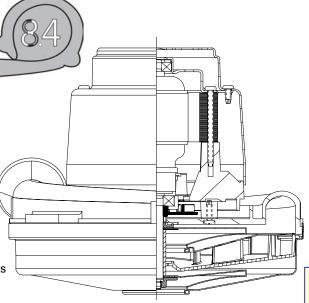

PRELIMINARY BULLETIN (SUBJECT TO CHANGE)

Model: 122177-00

SPECIAL FEATURES


- 1500+ hours life (Infinity Brush)
- 670 Peak Air Watts
- Up to 45% Overall Efficiency
- High efficient cooling system
- Lamb "Green Power Label"
- UL recognized, category PRGY2 (E47185)
- CSA certification pending
- Same mounting patern as Lamb's 7.2 tangential-bypass
- Optional filtered cooling air and locked-rotor, blocked cooling air and running overload protection
- Optional new patent-pending bearing protection for wet applications. (122178-18)

PEAK AIRWATTS 685


Calculated in accordance with ASTM F2105

TYPICAL MOTOR PERFORMANCE.

(At 240 volts, 60Hz, test data is corrected to standard conditions of 29.92 Hg, 68° F.)

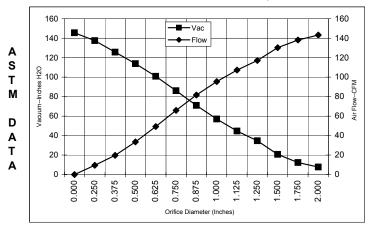

	(ln)				
	(111)		(In.H2O)	(CFM)	Watts
7.1	1598	22590	7.7	143.2	129
7.1	1605	22587	12.3	138.1	200
7.2	1614	22453	20.8	130.3	318
7.2	1610	22587	34.7	117.1	478
7.1	1598	22587	44.7	107.2	563
7.1	1592	22587	57.0	95.5	640
7.0	1576	22587	71.0	81.7	682
6.7	1513	22983	86.1	65.9	667
6.2	1412	23777	100.9	49.4	586
5.6	1272	24963	113.9	33.5	449
4.9	1118	26410	125.6	19.7	292
4.3	997	27730	137.5	9.5	153
3.8	884	29577	145.5	0.0	0
	7.1 7.2 7.2 7.1 7.1 7.0 6.7 6.2 5.6 4.9 4.3	7.1 1605 7.2 1614 7.2 1610 7.1 1598 7.1 1592 7.0 1576 6.7 1513 6.2 1412 5.6 1272 4.9 1118 4.3 997	7.1 1605 22587 7.2 1614 22453 7.2 1610 22587 7.1 1598 22587 7.1 1592 22587 7.0 1576 22587 6.7 1513 22983 6.2 1412 23777 5.6 1272 24963 4.9 1118 26410 4.3 997 27730	7.1 1605 22587 12.3 7.2 1614 22453 20.8 7.2 1610 22587 34.7 7.1 1598 22587 44.7 7.1 1592 22587 57.0 7.0 1576 22587 71.0 6.7 1513 22983 86.1 6.2 1412 23777 100.9 5.6 1272 24963 113.9 4.9 1118 26410 125.6 4.3 997 27730 137.5	7.1 1605 22587 12.3 138.1 7.2 1614 22453 20.8 130.3 7.2 1610 22587 34.7 117.1 7.1 1598 22587 44.7 107.2 7.1 1592 22587 57.0 95.5 7.0 1576 22587 71.0 81.7 6.7 1513 22983 86.1 65.9 6.2 1412 23777 100.9 49.4 5.6 1272 24963 113.9 33.5 4.9 1118 26410 125.6 19.7 4.3 997 27730 137.5 9.5

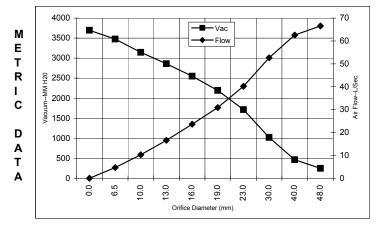


Orifice	Amps	Watts	RPM	Vac	Flow	Air
(mm)		(ln)		(mm H2O)	(L/Sec)	Watts
48.0	7.1	1601	22589	246	66.5	160
40.0	7.2	1611	22493	463	62.6	283
30.0	7.1	1603	22587	1021	52.7	525
23.0	7.0	1580	22587	1714	40.2	672
19.0	6.7	1511	22999	2193	30.9	665
16.0	6.2	1416	23745	2548	23.6	589
13.0	5.7	1286	24845	2860	16.6	463
10.0	5.0	1141	26193	3146	10.3	315
6.5	4.3	1003	27664	3478	4.7	160
0.0	3.8	884	29577	3696	0.0	0

Note: Metric Performance data is calculated from the ASTM data above.

^{*} Data represents performance of a typical motor sampled from a large production quantity. Individual motor data may vary due to normal manufacturing variations.

PRODUCT BULLETIN 122177-00

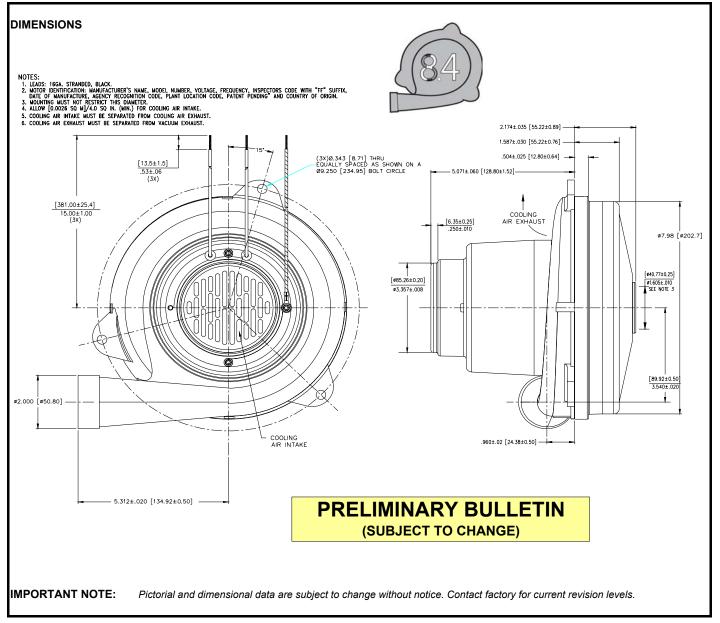

WARNING - When using AMETEK Floorcare & Specialty Motors (F&SM) bypass motors in machines that come in contact with foam, liquid (including water), or other foreign substances, the machine must be designed and constructed to prevent those substances from reaching the fan system, motor housing, and electrical components. F&SM vacuum motors other than hazardous duty models should not be applied in machines that come in contact with dry chemicals or other volatile materials. Failure to observe these precautions could cause flashing (depending on volatility) or electrical shockwhich could result in property damage and severe bodily injury, including death in extreme cases. All applications incorporating F&SM motors should be submitted to appropriate organizations or agencies for testing specifically related to the safety of your equipment.

AMETEK/Floorcare & Specialty Motors www.ametekfsm.com

Issued: March, 2009